

## **Product Description**

3M DICHROIC Glass Finish DF-PA (the "Product") offers a way to create unique, ever-changing color to many interior building surfaces. Influenced by the color of the substrate, this transparent Product provides a dichroic color effect, meaning it appears to change color when viewed at various angles. The "Blaze" Product shift colors in the warm tones of cyan/blue/magenta in transmission and red/gold color regions of the spectrum in reflection. The "Chill" Product shift colors in the cool tones of blue/magenta/yellow in transmission and gold/blue color regions of the spectrum in reflection. The Product has a clear, pressure-sensitive adhesive that can be applied to glass. A hard-coated, protective surface layer helps resist scratching during normal use. These decorative Products can be used in vertical applications on the surface of interior glass, including the interior of an outside glass wall (the "Interior Applications").

## **Application Surfaces**

The user is solely responsible for evaluating and determining whether these 3M Products are suitable and appropriate for any particular use or manufacturing process in which they may be used.

These application surfaces are based on test data deemed reliable but are not warranted.

- Glass
- Acrylic
- Polycarbonate

**NOTE:** Some plastic application surfaces can outgas. Outgassing is the release of a gas as certain plastics or coated surfaces dry and cure. This occurs over a period of time, but not indefinitely. Product that is applied to a surface that is still outgassing will develop air bubbles in the Product that may appear some time after the installation.

3M assumes no liability for bubbles that appear in the applied Product due to outgassing.

#### **Test a Plastic Application Surface for Outgassing**

- 1. Apply a 5 in. x 5 in. (135mm x 135mm) piece of the Product to the plastic application surface in question.
- 2. If possible, oven bake the sample for 2 hours at 150°F (65°C) or bake for 5 minutes at 350°F (176°C). If oven baking is not an option, allow the sample to sit at room temperature for 24 hours.
- 3. Examine the sample. Bubbles under the Product indicate that the plastic application surface is outgassing. If no bubbles occur, the application surface is not outgassing.
- 4. To estimate how long outgassing may continue, repeat the test daily, using a new sample, until bubbles no longer appear under the Product.
- 5. If outgassing continues for a long period of time, consult the plastic manufacturer for assistance.

#### **High Humidity Conditions**

Do not install DICHROIC Glass Finishes in locations in which the film may frequently come into contact with water or where condensation often occurs.



## **Installation Tools and Supplies**

- Rubber application squeegee, 4 in., rubber hardness 80, 6mm or greater thickness, nick free
- 3M<sup>™</sup> Hand Applicator PA-1 (Blue or Gold) with 3M<sup>™</sup> Low Friction Sleeve SA-1 (for use over the hand applicator)
- 4 in. Window scraper with stainless steel replacement blades
- 8 in. Window cleaning squeegee with replacement rubbers
- Razor blade knife with stainless steel replacement break-away blades
- Ruler with nick-free edges

- Scotch™ Masking Tape
- · Clean, lint-free paper towels
- Drop cloths (absorbent) or plastic sheeting
- Spray bottle (garden style 1 2 gallon, low pressure sprayer works well)
- Water
- Mild, non-lotion containing liquid detergent; no soaps, waxes, oils, or enzymes
- Isopropyl alcohol (70% or industrial strength)

## **Surface and Work Area Preparation**

Use the following steps to prepare the application surface for Product application. An experienced installer's techniques may vary.

#### **Prepare the Application Solution**

Prepare a water and liquid detergent solution to use for applying the finish. It should have a concentration of approximately 0.1% to 0.2% detergent. A solution of about 1 teaspoon of mild detergent to 1 gallon of water is sufficient for about 36 square yards of application surface. Pour this solution into your sprayer.

- High detergent concentration causes the squeegee and finish to slip, resulting in insufficient application pressure.
- Low detergent concentration causes the finish to stick or prevents the squeegee from traveling smoothly across the finish, which results in an inconsistent application and leaves excess water behind.

#### **Prepare the Installation Area**

- Protect the areas surrounding the installation from the application solution over spray and drips, using masking tape and/or drop cloths as appropriate.
- If possible, turn off or cover the heating or air conditioning units and ventilation ducts in the application area prior to starting the installation.
- For the best bonding conditions, the recommended application temperature is 60°F 100°F (16°C 38°C) and the application surface should be at room temperature or higher. In the lower end of this range, additional application pressure on the Product can encourage better adhesive bonding. Attempting to install the Product at temperatures below the recommended range can cause the adhesive to become so firm that it will not develop maximum contact with the application surface.

#### **Measure and Cut the Panels**

Product panels may be cut to size by hand or electronically cut. If cut by hand, any nicks or burrs on the edge of the ruler used to mark and cut the finish could scratch it. Apply masking tape to the side of the ruler that contacts the finish to help prevent damage. Use a very sharp cutting blade to ensure clean, smooth edges.

This Product may be cut using electronic cutting equipment, but the user must test and approve with their equipment to determine suitability. The user must identify a suitable prespacing tape that adheres properly to the face of the Product to hold cut shapes in place.

- 1. Use clean, sharp blades that are set to the proper depth to avoid cutting the liner.
- 2. Apply a prespacing tape to hold the cut pieces together during installation.
- 3. Roll the Product onto a 6 in. (15 cm) core, liner side in, or lay flat until ready to use.
- 4. Always apply the product as soon after cutting as possible.
- 5. Weeding the excess Product should be weeded (removed) as soon as practical. This is to minimize the possible effect of adhesive flow 24 or more hours after cutting.

## **Surface and Work Area Preparation (continued)**

#### **Check the Application Surface for Coatings**

Many application surfaces have wax or other invisible coatings on them that interfere with adhesion. Use the following procedure to identify and eliminate such coatings. Be sure your customer understands and agrees with this procedure.

- Place drops of water on several areas of the application surface. Water beads indicate that the glass or plastic has a coating that must be removed for good Product adhesion.
- Saturate a lint-free paper towel with 70% isopropyl alcohol (IPA) and wipe clean the application surface. Wipe the application surface clean before the IPA evaporates with a lint-free paper towel.
- Check again for water beading. If there is no beading, proceed with application surface preparation.

#### **Clean the Application Surface**

- 1. Place drop cloths and/or plastic sheeting to protect the application area below the application surface.
- 2. Spray the application solution on the application surface.
- Scrape glass to remove dirt and other contaminants on the surface of the glass.

NOTE: Do not scrape plastic surfaces as this will cause scratches that may show through the Product.

- 4. Thoroughly rinse the application surface using the sprayer, then squeegee the entire application surface, wiping the squeegee after each stroke.
- 5. Dry the application surface edge and frame thoroughly.
- 6. Apply the Product per the installation procedure immediately after cleaning the application surface. Any dirt or contaminates which settle on the application surface after cleaning will inhibit adhesion and may be visible after application.

#### Installation Procedure

**NOTE:** Bring the Product to room temperature before installation.

#### Remove the Liner and Wet the Adhesive

- Generously spray the application surface with the application solution.
- Lay the FRONT SIDE of the Product against the application surface so the liner is facing you.
- Peel back a few inches of the liner. Be sure you pull the liner away from the Product, not the Product from the liner, to avoid stretching the Product.

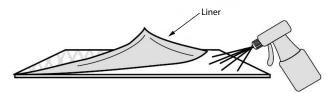


Figure 1. Peel back some liner and spray the adhesive.

- 4. Generously spray the exposed adhesive with the application solution.
- 5. Continue peeling back the liner and spraying the adhesive with the application solution until the liner is completely removed.

**NOTE:** If the Product panel is large, you may need assistance for the next steps.

6. Flip the Product and position it on the wetted application surface so the adhesive contacts the application surface.

### **Installation Procedure (continued)**

#### **Apply Product**

- 1. Recheck the alignment, spray the surface of the Product with application solution to reduce friction.
- 2. Apply the Product using a hand applicator.
- 3. Starting at the top in the center of the finish, use firm and consistent pressure, making overlapping strokes from center to edges with the applicator. The goal is to push the water out to the edges so the adhesive makes good contact with the application surface.
- 4. For the rest of the panel, move the applicator down to overlap the previous strokes by about 50%, and stroke from center to edge, center to edge again, until the panel is fully applied.
- 5. Wipe the edges of the Product with a clean, lint-free towel to remove any drips.

## **Cleaning and Maintenance**

After the application is complete, some application solution may remain between the glass and the finish. This causes small water bubbles or clouding that disappears as the water evaporates. This can take up to several days, depending on environmental conditions.

- Do NOT touch the finish during this time.
- Protect the finish from abuse.

**NOTE:** The Product may be cleaned beginning 30 days after installation.

#### **Cleaning Applied Product**

Regular cleaning will help maintain the Product's appearance. Use only clean, nick-free tools and wipe gently only in one direction. Do not use ammonia, chlorine, or organic-based cleaning products, polishing or cleaning compound, sponges, brushes or electric polishing equipment:

- If there is dust and grit, wipe it off with a soft, damp cloth.
- If it is soiled, but not gritty, use water and squeegee.
- If there is heavier soil, use a mild liquid detergent and water solution, then clear water, and wipe gently with a cloth wipe.

NOTE: Additional caution is recommended when cleaning spliced areas. Always clean in the direction of the splice.

#### Removal

The Product can be removed with low heat or the use of 3M Adhesive Remover Citrus Base and a scraper.

#### **Transportation and Storage**

- 40° to 90°F (4° to 32°C)
- · Away from direct sunlight
- Clean dry area
- Original container

## **Health and Safety**

! CAUTION

When handling any chemical products, read the manufacturers' container labels and the Safety Data Sheets (SDS) for important health, safety and environmental information. To obtain SDS sheets for 3M products go to <u>3M.com/MSDS</u>, or by mail or in case of an emergency, call 1-800-364-3577 or 1-651-737-6501.

When using any equipment, always follow the manufacturers' instructions for safe operation.

## 3M<sup>™</sup> DICHROIC Glass Finishes DF-PA Chill & DF-PA Blaze



## CAUTION: Risk of Glass Breakage Due to Thermal Expansion

Glass surfaces exposed to sunlight will absorb heat. A glass surface covered by a film with high opacity or dark-colored ink, including films with small areas of high opacity or dark-colored ink, will absorb more heat. Heat absorption can create thermal stress that results in glass breakage, or thermal cracking. This can cause personal injury and property damage. 3M specifically does not recommend using a film with high opacity or dark-colored ink on glass surfaces with significant exposure to sunlight.

#### **Technical Information**

Technical information and data, recommendations, and other statements provided by 3M are based on information, tests, or experience which 3M believes to be reliable, but the accuracy or completeness of such information is not guaranteed. Such technical information and data are intended for persons with knowledge and technical skills sufficient to assess and apply their own informed judgment to the information. The typical values shown should not be used for the purpose of specification limits. If you have questions about this Product, contact the Technical Service helpline at 1-888-650-3497.

For more information or to order samples, please visit 3M.com/DICHROIC.

#### WARRANTY

#### **Limited Warranty**

- 1. 3M warrants that a Product will be free from defect in manufacture ("3M Warranty") on 3M's Product shipment date ("Warranty Period"). EXCEPT TO THE EXTENT PROHIBITED BY APPLICABLE LAW, THE 3M WARRANTY IS MADE IN LIEU OF ALL OTHER WARRANTIES, RIGHTS OR CONDITIONS, EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE AND THOSE ARISING FROM A COURSE OF DEALING, CUSTOM OR USAGE OF TRADE. THE BUYER IS RESPONSIBLE FOR DETERMINING IF A PRODUCT IS SUITABLE FOR ITS PARTICULAR PURPOSE AND APPLICATION METHODS.
- 2. For a buyer's convenience, 3M may provide engineering or technical information, recommendations, installation instructions, and other information or materials relating to Product ("Other Product Information"), but 3M makes only the 3M Warranty and does not warrant any Other Product Information.
- 3. 3M has no obligation under the 3M Warranty as to Product that has been: (a) modified, altered or processed in any manner; (b) stored, applied, installed, or used in a manner other than that 3M recommends in this Technical Data Sheet and in all Other Product Information; (c) damaged through contact with a person or thing, misuse, accident, neglect, or other action by anyone other than 3M; or (d) exposed to excessive heat, humidity, dirt or UV light.

#### **Limited Remedy**

If any Product is proven not to have met the 3M Warranty on the buyer's receipt, then the buyer's exclusive remedy, and 3M's sole obligation, will be, at 3M's option, to replace that Product quantity or refund the applicable purchase price.

#### **Limitation of Liability**

3M WILL NOT UNDER ANY CIRCUMSTANCES BE LIABLE TO A BUYER FOR DIRECT (other than the Limited Remedy stated above), SPECIAL, INCIDENTAL, INDIRECT OR CONSEQUENTIAL DAMAGES (INCLUDING, WITHOUT LIMITATION, LOSS OF PROFITS) IN ANY WAY RELATED TO A PRODUCT, THIS PRODUCT BULLETIN/TECHNICAL DATA SHEET, OR OTHER PRODUCT INFORMATION, REGARDLESS OF THE LEGAL OR EQUITABLE THEORY ON WHICH SUCH DAMAGES ARE SOUGHT.

# 3M Commercial Solutions 3M U.S.

3M Center Building 220-12E-04 St. Paul, MN 55144-1000 1-888-650-3497 3M.com/AMD

#### 3M Canada

1840 Oxford St E London, ON N5V 3R6 1-800-265-1840

#### 3M Commercial Solutions 3M Europe

1831 Diegem Belgium www.3M.eu/ArchitecturalMarkets

Hermeslaan 7

# 3M Commercial Solutions 3M Italia, S.p.A.

Via Nortberto Bobbio, 21 20096 Pioltello MI Tel. 02.7035.2517 3mitalia.it

#### 3M India Limited Commercial Solutions

Concorde Blook, UB City 24 Vittal Mallya Road, Bangalore 560 001 Tel: 080 2223 1414 | Fax: 080 2223 1450 3minteriors.in@mmn.com

#### 3M Commercial Solutions 3M Gulf

PO Box 20191, Dubai Internet City Building @ 11 Dubai, United Arab Emirates Tel. 971 4 3670 777 | Fax 971 4 3670 998

